GRANT Check-Up

VEHICLE INSPECTION REPORT

Inspection date and time
18.09.2026, 13:30
Report No. GC-2026-0918-01



Toyota Auris Touring Sports 1.8 Hybrid

Estate · hybrid: petrol 1 798 cc + electric motor, 136 hp · gearbox: e-CVT · front-wheel drive · white

VIN	Registration	Mileage (odometer)	Mileage history
SB1ZS3JE10E******	**-**-**	177 752 km	confirmed
First registration	**Certified used, warranty**	**IPO inspection (MOT)**	**Inspection conditions**
28.12.2017, Portugal	no	valid to 28.12.2026	on site, no vehicle lift

VEHICLE CONDITION

8 out of 10

rating takes age and mileage into account

RATING SCALE

9-10	as new, no remarks
7-8	**good, routine servicing and minor work**
5-6	fair, component repairs needed
3-4	serious defects
1-2	accident-damaged or not roadworthy

431	413	10	8	157	2
checks completed	OK	Remark	Service required	photos	videos

KEY FINDINGS

- **Service required** — **Lights.** Rear left brake light not working: bulb replacement required.
- **Service required** — **Road test.** Slight steering wheel vibration at 100-120 km/h: wheel balancing required.
- **Service required** — **Engine.** Ancillary drive bearing noise: diagnosis and bearing replacement required.
- **Service required** — **Brakes.** Rear brake discs worn: replace at next pad change. photo 086
- **Service required** — **Interior.** Interior deep cleaning (valeting) required: grease marks, soiled headlining. photo 107
- **Service required** — **Keys.** Second key has no emergency key blade: a blade must be cut. photo 104
- **Remark** — **Tyres.** Tread 3.8-4.6 mm (about 50%), different brands per axle. photo 081
- **Remark** — **Body.** Bonnet 120-166 µm, above 160 µm at some points: repaint zone on the report scale. photo 029
- **Remark** — **Body.** Front bumper: gap at left corner; trim above left headlamp refitted; right trim in a different shade. photo 061, 062
- **Remark** — **Battery.** 12 V: 11.6 V at rest, charging and capacity test required. photo 138

IN GOOD ORDER

- No fault codes in control units, malfunction indicator lamp off.
- Mileage of 177 752 km confirmed by 2017-2026 documents and control units.
- Hybrid battery: block spread 0.05 V; Toyota check on 17.09.2026 passed.
- Inverter replaced by Toyota dealer in 03.2026.
- Outer panels except the bonnet in original factory paint; glass and headlamps not replaced.
- IPO inspection passed, valid to 28.12.2026.
- No suspension knocks, even braking, no disc judder.

VIDEO

Road test

Steering, air conditioning, reversing camera

All photos and videos in full size

Condition by section

Each section shows how many checks were made and what was found. Dot colour: ● all checks OK, ● remarks present, ● items requiring service. Items not relevant to this vehicle (diesel, turbo, four-wheel drive, electric vehicle, etc.) are listed at the end of each section under “Not applicable”.

Documents and identification ●
15 checks · OK 14 · service 1

Body: condition of each panel ●
60 checks · OK 59 · remarks 1

Body: panel gaps by side ●
16 checks · OK 15 · remarks 1

Body: doors, locks, fittings ●
15 checks · OK 13 · remarks 2

Paintwork and repair evidence ●
12 checks · OK 11 · remarks 1

Glazing ●
14 checks · OK 14

Headlamps, mirrors, wipers ●
10 checks · OK 10

Exterior lighting ●
26 checks · OK 25 · service 1

Engine: under-bonnet inspection ●
16 checks · OK 15 · service 1

Start-up and stationary running ●
12 checks · OK 12

Hybrid and electrical system ●
6 checks · OK 6

Diagnostic scan ●
6 checks · OK 5 · remarks 1

Wheels, tyres, brakes: per wheel ●
40 checks · OK 34 · remarks 4 · service 2

Running gear: inspection with wheels on full lock, per wheel ●
38 checks · OK 36 · not visible 2

Interior ●
29 checks · OK 27 · service 2

Climate control ●
14 checks · OK 14 · not fitted 2

Door mirrors ●
12 checks · OK 12


Comfort: fitted, not fitted, working ●
23 checks · OK 23 · not fitted 9

Instruments and multimedia ●
20 checks · OK 20

Boot and rear seats ●
12 checks · OK 12

Road test ●
37 checks · OK 36 · service 1

Body diagram: paint thickness, µm

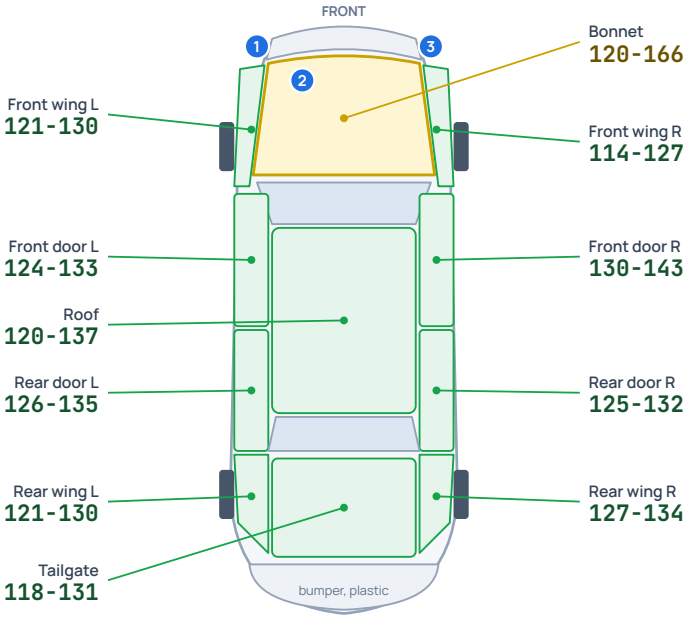

- up to 160 µm: factory paint
- remark
- 160-300 µm: repainted
- over 300 µm: body filler

Paint thickness gauge
Horstek TC 215

Pillars and sills
57-89

Door apertures
53-84

Bumpers
plastic, colour match

1 Gap at left corner of front bumper 061

2 Trim above left headlamp: clip refitted 062

3 Right bumper trim: different shade

● Documents and identification

15 checks · OK 14 · service 1

DUA (vehicle registration certificate)	OK	Original, all data legible.

Documents and identification

15 checks · OK 14 · service 1

VIN	OK	VIN present on body, matches documents, no visible damage to the plate.
Registration	OK	**-**-**, matches DUA. photo 001, 147
Make, model, fuel, colour	OK	Match DUA.
First registration	OK	28.12.2017, Portugal. photo 156
IPO inspection (MOT)	OK	Passed with no defects, valid to 28.12.2026. photo 147
IUC (annual road tax), current year	OK	Paid.
Service history	OK	13 documents 2018-2026: servicing at official Toyota dealer, then Norauto. photo 149, 152, 155, 158, 151, 157, 154, 160
Last service	OK	Oil change on 16.09.2026 at 177 706 km. photo 160
Mileage per documents	OK	Only increases, matches odometer and control units: 177 752 km. photo 135, 139
Approved used vehicle from official dealer, manufacturer warranty	OK	Not sold under the Toyota Approved programme, factory warranty expired. Toyota hybrid system check on 17.09.2026: certificate valid for 1 year / 15 000 km; the Toyota report refers to the hybrid battery extra coverage programme. photo 146, 148
Number of keys	Service required	2 keys. The second has no metal emergency key blade: a blade must be cut. photo 103, 104
Key 1: unlocking and starting	OK	Working. photo 103
Key 2: unlocking and starting	OK	Working. photo 104
Owner's manual	OK	In the vehicle.

Not applicable to this vehicle (1): import documents (DAV) and ISV (vehicle registration tax) for vehicles from another country.

Mileage history per documents

DATE	MILEAGE, KM	WORK DONE	PHOTO
28.12.2017	-	Sold new, first registration	156
01.08.2018	11 498	Warranty service at Toyota dealer	152
16.07.2020	32 972	Front tyres replaced, wiper blades	149
15.01.2021	48 630	Interior cleaning, battery test	159
26.07.2021	62 170	Rear tyres replaced, wheel alignment	150
18.01.2022	76 291	Dealer service	155
08.02.2023	106 355	Dealer service, rear brake pads	158
25.06.2024	134 135	Dealer service, battery cooling maintenance	151
06.02.2025	147 219	Norauto service	157
01.10.2025	162 036	Norauto service	154
19.03.2026	169 263	Dealer: inverter and converter replaced	153
16.09.2026	177 706	Oil change	160
17.09.2026	177 732	Toyota hybrid system check: passed	148
18.09.2026	177 752	GRANT Check-Up inspection: odometer and control units	135

Body: condition of each panel

60 checks · OK 59 · remarks 1

	DENTS	SCRATCHES	STONE CHIPS	RUST
Bonnet	no	no	a few small	no

Body: condition of each panel

60 checks · OK 59 · remarks 1

	DENTS	SCRATCHES	STONE CHIPS	RUST
Roof	no	no	no	no
Tailgate	no	no	no	no
Front wing left	no	no	no	no
Front door left	no	no	small, on edge	no
Rear door left	no	no	no	no
Rear wing left	no	no	no	no
Sill left	no	no	no	no
Front wing right	no	no	no	no
Front door right	no	no	no	no
Rear door right	no	no	no	no
Rear wing right	no	no	no	no
Sill right	no	no	no	no
Front bumper	gap at left corner	no	no	no
Rear bumper	no	trim scuffed	no	no

Not applicable to this vehicle (4): convertible roof: mechanism; convertible roof: fabric or panels; sunroof or panoramic roof exterior; sliding doors.

Body: panel gaps by side

16 checks · OK 15 · remarks 1

	LEFT SIDE	RIGHT SIDE
Bonnet and wing	even	even
Front door	even	even
Rear door	even	even
Tailgate	even	even
Front bumper	small gap	even
Rear bumper	even	even
Headlamp	even	even
Rear lamp	even	even

Body: doors, locks, fittings

15 checks · OK 13 · remarks 2

Panel shade on walk-round	Remark	Black textured trim on front bumper, right side, differs in shade from the other trims.
Trim above left headlamp	Remark	Clip was unseated, refitted. photo 062
Front left door: opening from outside and inside	OK	Working, no sag.
Front right door: opening from outside and inside	OK	Working, no sag.
Rear left door: opening from outside and inside	OK	Working, no sag.
Rear right door: opening from outside and inside	OK	Working, no sag.
Door check straps	OK	Hold the door.
Bonnet: catch and stay	OK	Working. photo 050

Body: doors, locks, fittings

15 checks · OK 13 · remarks 2

Tailgate: lock and struts	OK	Working.
Door and tailgate seals	OK	Intact. photo 119
Mouldings and wheel arch trims	OK	In place; scuffs on wheel arch trims. photo 071, 076
Radiator grille and badges	OK	Intact. photo 001
Roof rails	OK	Intact.
Fuel filler flap and cap	OK	Opens, intact.
Number plates and surrounds	OK	Intact, legible. photo 001, 002

Not applicable to this vehicle (3): tow bar; powered tailgate; charging port flap.

Paintwork and repair evidence

12 checks · OK 11 · remarks 1

Paint thickness on 10 panels	OK	114-143 µm: factory paint. Values on the diagram. photo 005, 009, 010, 016
Bonnet	Remark	120-166 µm, above 160 µm at some points: repaint zone on the report scale. photo 028, 029, 030
Pillars and sills	OK	57-89 µm, factory paint. photo 018, 037, 039
Door apertures	OK	53-84 µm, factory paint. photo 011, 013, 017, 020, 036
Overspray on rubbers and mouldings	OK	None.
Different gloss or shade of adjacent panels	OK	None (except right bumper trim, plastic).
Dust or runs under the lacquer	OK	None.
Plastic bumpers	OK	Colour matches body, no paint cracks.
Body panel bolts	OK	Not disturbed: wings, bonnet, door and tailgate hinges. photo 050, 051
Sealant in apertures and under bonnet	OK	Factory original.
Chassis legs under bonnet	OK	No creases, welding or repair evidence. photo 053
Front panel and strut towers	OK	Original, no repair evidence. photo 052, 054

Not applicable to this vehicle (1): aluminium and composite panels (measured with another probe or visually).

Glazing

14 checks · OK 14

	CHIPS AND CRACKS	NOT REPLACED (MARKING)
Windscreen	no	factory
Rear window	no	factory
Front left	no	factory
Front right	no	factory
Rear left	no	factory
Rear right	no	factory
Fixed side windows (2)	no	factory

Not applicable to this vehicle (2): heated windscreen; head-up display (HUD).

Headlamps, mirrors, wipers

10 checks · OK 10

Headlamps: cracks, clouding, moisture	OK	None. photo 063, 064
Headlamps not replaced	OK	Both original Toyota. photo 055, 056
Rear lamps: cracks, moisture	OK	None. photo 077
Mirrors: housings and glass	OK	Intact.
Wiper blades	OK	Wipe without streaks.
Wipers: intermittent mode	OK	Working.
Wipers: speed 1 and 2	OK	Working.
Rear wiper	OK	Working.
Windscreen washer	OK	Working.
Rear screen washer	OK	Working.

Not applicable to this vehicle (1): headlamp washers.

Exterior lighting

26 checks · OK 25 · service 1

Dipped beam, left headlamp	OK	**Dipped beam, right headlamp**	OK
Main beam, left headlamp	OK	**Main beam, right headlamp**	OK
Front side light, left	OK	**Front side light, right**	OK
Daytime running light, left	OK	**Daytime running light, right**	OK
Front indicator, left	OK	**Front indicator, right**	OK
Mirror repeater, left	OK	**Mirror repeater, right**	OK
Rear indicator, left	OK	**Rear indicator, right**	OK
Front fog lamp, left	OK	**Front fog lamp, right**	OK
Brake light, rear left — Service required Not working. Bulb replacement required.		**Brake light, rear right**	OK
Tail light, left	OK	**Tail light, right**	OK
High-level brake light	OK	**Hazard warning lights**	OK
Rear fog lamp	OK	**Reversing light**	OK
Number plate light	OK	**Headlamp levelling**	OK

Not applicable to this vehicle (2): adaptive or matrix headlamps; cornering lights.

Engine: under-bonnet inspection

16 checks · OK 15 · service 1

Engine bay: general condition	OK	Clean, no signs of washing or leaks. photo 052
Oil leaks at top and front of engine	OK	None.
Oil level	OK	Between the marks. photo 060
Oil condition	OK	Clean, no emulsion or fuel smell. photo 060
Oil filler cap underside	OK	Clean. photo 059
Engine coolant: level, colour	OK	Normal, clean. photo 057
Radiator	OK	Fins intact, no seepage.
Coolant hoses	OK	Flexible, dry at the clips.
Brake fluid	OK	Level normal.

Engine: under-bonnet inspection

16 checks · OK 15 · service 1

Washer fluid	OK	Present.
12 V battery: case, terminals, mounting	OK	Terminals clean, secured.
Ancillary drive: bearings	Service required	Bearing noise at the front right of the engine bay. Diagnosis and bearing replacement required.
Timing drive: belt or chain	OK	Chain.
Timing belt replacement: date and mileage per documents	OK	Chain, no scheduled replacement required.
Wiring	OK	No splices or non-standard wiring.
Signs of tampering	OK	None.

Not applicable to this vehicle (5): turbocharger and boost hoses; intercooler; power steering reservoir; LPG system; AdBlue tank (diesel).

Start-up and stationary running

12 checks · OK 12

Starting	OK	READY system activates immediately, engine starts without delay.
Warning lamps at ignition	OK	Light up and go out after start-up. photo 135
Engine noise on start-up	OK	No rattle or knock.
Idle	OK	Smooth.
Vibration at idle	OK	None.
Engine running noise	OK	No knock or whistle.
Smoke on start-up	OK	None.
Smoke on revving	OK	None.
Soot in tailpipe	OK	Dry. photo 133, 134
Cooling fan	OK	Switches on.
Gearbox: P, R, N, D when stationary	OK	No jolts or delays.
Drips under the vehicle after running	OK	None.

Not applicable to this vehicle (4): manual: clutch travel and gear engagement; automated manual or DSG: gear engagement when stationary; four-wheel drive: mode engagement; diesel: glow plug start time.

Hybrid and electrical system

6 checks · OK 6

High-voltage cables and connectors	OK	Visual inspection: insulation and connectors intact. photo 058
Inverter cooling	OK	Level normal, coolant clean. photo 058
Battery cooling fan	OK	Working quietly.
READY indicator and EV mode	OK	Working. photo 135
Inverter	OK	Replaced by Toyota dealer on 19.03.2026 at 169 263 km. photo 153
Dealer hybrid system check	OK	Toyota, 17.09.2026, 177 732 km: passed. photo 146, 148

Not applicable to this vehicle (5): charging port; charging cable; AC charging test; DC rapid charging test; range shown on instruments.

Diagnostic scan

6 checks · OK 5 · remarks 1

Control units	OK	6 control units scanned: engine, hybrid system, transmission, ABS and stability control, airbags, driver assistance. No fault codes found. photo 137
Malfunction indicator lamp (Check Engine)	OK	Off. photo 138
When fault codes were cleared	OK	7 797 km ago (at 169 955 km), about 700 km after the inverter replacement at the Toyota dealer at 169 263 km. photo 138
Mileage in control units	OK	177 752 km, matches odometer. photo 139, 145
12 V battery	Remark	11.6 V at rest. Battery charging and capacity test required. photo 138
High-voltage battery	OK	Voltage spread across 14 blocks 0.05 V, normal. Toyota check on 17.09.2026: passed. photo 140, 141, 142, 148

The number of control units depends on the vehicle: 6-10 on simpler models, 25-30 or more on Mercedes, BMW, Porsche. The report states the actual number from the scanner.

Not applicable to this vehicle (2): traction battery state of health (SOH), % (electric vehicles and plug-in hybrids); particulate filter: soot load (diesel).

Wheels, tyres, brakes: per wheel

40 checks · OK 34 · remarks 4 · service 2

	FRONT LEFT	FRONT RIGHT	REAR LEFT	REAR RIGHT
Tyre: brand	Firestone	Firestone	Three-A	Three-A
Tyre: year of manufacture	2024	2024	2023	2023
Tread depth, mm	4.6	4.5	3.9	3.8
Even wear across width	OK	OK	OK	OK
Sidewall: cuts, bulges	no	no	no	no
Wheel rim	OK	OK	kerbed	OK
Brake disc	OK	OK	worn, lip	worn, lip
Pads (visible remaining)	50%	50%	80%	80%
Caliper	OK	OK	OK	OK
Brake hose	OK	OK	OK	OK

Tyres: size 225/45 R17 94W, matches the placard; different brands per axle. Tread about 50%. Rear brake discs: replacement required at next pad change. Photos 080-090.

Not applicable to this vehicle (4): locking wheel nut key; tyre pressure sensors (direct); run-flat tyres; ceramic brakes.

Running gear: inspection with wheels on full lock, per wheel

38 checks · OK 36 · not visible 2

	FRONT LEFT	FRONT RIGHT	REAR LEFT	REAR RIGHT
Driveshaft boot, outer	OK	OK	-	-
Driveshaft boot, inner	OK	OK	-	-
Ball joint boot	OK	OK	-	-
Track rod end: boot	OK	OK	-	-
Steering rack gaiter	OK	OK	-	-
Anti-roll bar link	OK	OK	OK	OK
Suspension arm: visible part, bush	OK	OK	OK	OK
Shock absorber: dust cover, bump stop	OK	OK	OK	obscured
Shock absorber: misting, leakage	dry	dry	dry	obscured

Running gear: inspection with wheels on full lock, per wheel

38 checks · OK 36 · not visible 2

	FRONT LEFT	FRONT RIGHT	REAR LEFT	REAR RIGHT
Coil spring	OK	OK	surface rust	surface rust
Leaks around running gear	no	no	no	no
Body bounce at this corner	OK	OK	OK	OK

Steering lock to lock: smooth, no jerks or knocks. Photos 125-132.

Not applicable to this vehicle (3): air suspension: air springs, ride height retention; adaptive dampers; four-wheel drive: rear driveshaft boots.

Interior

29 checks · OK 27 · service 2

Interior odour	OK	No unusual odours.
Driver's seat: upholstery	OK	No holes or burns, side bolster not worn. photo 091, 092, 093
Passenger seat: upholstery	OK	No damage. photo 124
Rear seat: upholstery	OK	No damage. photo 108, 114
Steering wheel: wear	OK	Consistent with mileage. photo 098, 099
Gear selector and pedals: wear	OK	Consistent with mileage.
Dashboard	OK	No cracks. photo 106, 123
Airbag covers	OK	Intact, no signs of opening.
Centre console	OK	Buttons and lids intact. photo 100, 101
Armrest	OK	Intact, lid latches. photo 102
Front left door card	OK	Minor scuffs on plastic. photo 094
Front right door card	OK	Intact. photo 120
Rear left door card	OK	Minor scuffs. photo 110
Rear right door card	OK	Intact. photo 113
Headlining	Service required	Not sagging, no signs of leaks. Localised soiling: cleaning required. photo 107, 115, 116
Interior cleanliness	Service required	Grease marks on plastics and fabric. Interior deep cleaning (valeting) required. photo 069, 112
Carpets and floor	OK	Dry, no signs of water.
Driver's seat belt	OK	Retracts, buckle works.
Front passenger seat belt	OK	Retracts, buckle works.
Rear left seat belt	OK	Working.
Rear centre seat belt	OK	Working.
Rear right seat belt	OK	Working.
Driver's sun visor	OK	Holds position, mirror intact.
Passenger sun visor	OK	Holds position, mirror intact.
Front interior light	OK	Works.
Rear interior light	OK	Works.
Interior rear-view mirror	OK	Intact.
Glovebox	OK	Opens and closes.
ISOFIX anchorages	OK	In place, 2 seats.

Not applicable to this vehicle (2): leather upholstery: cracks and colour; third seat row.

Climate control

14 checks · OK 14 · not fitted 2

Air conditioning: cools	6 °C	OK	Heater: heats	hot air	OK
Face vents	working	OK	Footwell vents	working	OK
Windscreen demist	working	OK	Combined modes	working	OK
Fan speeds	all	OK	Recirculation	working	OK
Automatic mode	working	OK	Driver zone	adjustable	OK
Passenger zone	adjustable	OK	Heated rear window	working	OK
Heated windscreen	Not fitted		Rear climate control	Not fitted	
Odour from vents	no	OK	Vents: louvres	intact	OK

Not applicable to this vehicle (1): auxiliary heater.

Door mirrors

12 checks · OK 12

	UP	DOWN	LEFT	RIGHT	FOLDING	HEATING
Left mirror	OK	OK	OK	OK	OK	OK
Right mirror	OK	OK	OK	OK	OK	OK

Not applicable to this vehicle (2): auto-dimming mirrors; mirror memory.

Comfort: fitted, not fitted, working

23 checks · OK 23 · not fitted 9

Electric window, front left	working	OK	Electric window, front right	working	OK
Electric window, rear left	working	OK	Electric window, rear right	working	OK
Window controls on driver's door	working	OK	Rear window lock-out	working	OK
Heated driver's seat	working	OK	Heated passenger seat	working	OK
Heated rear seats	Not fitted		Ventilated seats	Not fitted	
Electric seat adjustment	Not fitted		Heated steering wheel	Not fitted	
Driver's seat: fore-aft	working	OK	Driver's seat: height	working	OK
Driver's seat: backrest recline	working	OK	Passenger seat: fore-aft	working	OK
Passenger seat: backrest recline	working	OK	Steering wheel: height and reach	working	OK
Central locking by button	working	OK	Central locking by key	working	OK
Keyless entry	working	OK	Start button	working	OK
Cruise control	working	OK	Rain sensor	working	OK
Light sensor	working	OK	Automatic main beam	working	OK
Reversing camera	working	OK	Front parking sensors	Not fitted	
Rear parking sensors	Not fitted		Sunroof or panoramic roof	Not fitted	
Powered tailgate	Not fitted		Surround-view cameras	Not fitted	

Instruments and multimedia

20 checks · OK 20

Instrument cluster	working	OK	Trip computer	working	OK
Instrument illumination	even	OK	Warning messages on cluster	no	OK
Multimedia screen and touch	working	OK	Radio	working	OK
Navigation	working	OK	Bluetooth: phone	pairs	OK
Bluetooth: audio	working	OK	USB	working	OK

Speaker, front left	working	OK	Speaker, front right	working	OK
Speaker, rear left	working	OK	Speaker, rear right	working	OK
Steering wheel buttons	working	OK	Left stalk switch	all modes	OK
Right stalk switch	all modes	OK	Horn	working	OK
12 V socket	working	OK	Aftermarket equipment	no	OK

Not applicable to this vehicle (3): Apple CarPlay and Android Auto; wireless charging; head-up display.

Boot and rear seats

12 checks · OK 12

Rear seat backrest folding	OK	Fold and latch.
Rear head restraints	OK	In place.
Rear door child locks	OK	Switch over. photo 109
Load cover	OK	Intact, mountings in place.
Boot trim and carpet	OK	Intact, dry.
Under-floor well: water, rust, repairs	OK	Dry, no rust or repairs.
Spare wheel or repair kit	OK	Repair kit present, sealant in date.
Jack and wheel brace	OK	In place.
Towing eye	OK	In place.
Warning triangle and hi-vis vest	OK	In place.
Boot light	OK	Works.
Boot aperture seal	OK	Intact, dry.

Not applicable to this vehicle (1): front luggage compartment (electric and rear-engined vehicles).

Road test

37 checks · OK 36 · service 1

Road test conditions	OK	GRANT AUTO mechanic, 25 minutes: urban and motorway, up to 120 km/h, gradients.
Pulling away	OK	Smooth.
Acceleration	OK	Even, no flat spots.
Throttle response	OK	No delay.
e-CVT operation	OK	Smooth, no jolts.
Electric-only driving	OK	Drives on the electric motor.
Engine engagement	OK	Smooth, no jolt.
Regenerative braking	OK	Working.
Engine under load	OK	No knocking or rattling.
Temperature while driving	OK	Stable.
Pulling when driving straight	OK	None.
Steering wheel position when driving straight	OK	Centred.
Steering free play	OK	None.
Steering self-centring	OK	Self-centres.
Steering wheel vibration at speed	Service required	Slight steering wheel vibration at 100-120 km/h. Wheel balancing required.

Road test

37 checks · OK 36 · service 1

Body vibration at speed	OK	None.
Braking: efficiency	OK	Strong.
Braking: pulling	OK	None.
Brake disc judder through pedal	OK	None.
Brake disc judder through steering wheel	OK	None.
Brake squeal	OK	None.
Parking brake on a gradient	OK	Holds.
Front suspension knocks	OK	None.
Rear suspension knocks	OK	None.
Driveshaft clicking on full lock	OK	None.
Wheel bearing hum	OK	None.
Gearbox and final drive whine	OK	None.
Body roll in corners	OK	None.
Rattles and wind noise in cabin	OK	None.
Cruise control on the move	OK	Working.
Lane keeping assist	OK	Working.
Traffic sign recognition	OK	Working.
Warning lamps during the drive	OK	None appeared.
After the drive: leaks under bonnet	OK	None.
After the drive: burning smell	OK	None.
Hot restart	OK	Immediate.
Fault codes after the drive	OK	No new codes.

Not applicable to this vehicle (7): manual: clutch and gear change; automated manual or DSG: jerking when pulling away; conventional automatic: harsh shifts; turbo: boost response and whistle; four-wheel drive: differential noise; air suspension: ride height modes; electric vehicle: range and consumption.

VIDEO Road test Steering, air conditioning, reversing camera All photos and videos

Inspector's conclusion

Overall condition: 8 out of 10 (good: routine servicing and minor work). Checks completed: 431. OK 413, remarks 10, service required 8, not visible without a lift 2.

Service required

- Lights: rear left brake light not working: bulb replacement required.
- Road test: slight steering wheel vibration at 100-120 km/h: wheel balancing required.
- Engine: ancillary drive bearing noise: diagnosis and bearing replacement required.
- Brakes: rear brake discs worn: replace at next pad change.
- Interior: deep cleaning (valeting) required: grease marks, soiled headlining.
- Keys: second key has no emergency key blade: a blade must be cut.

Remarks

- Tyres: tread 3.8-4.6 mm (about 50%), different brands per axle.
- Body: bonnet 120-166 µm, above 160 µm at some points: repaint zone on the report scale.
- Body: front bumper: gap at left corner; trim above left headlamp refitted; right trim in a different shade.
- Battery: 12 V: 11.6 V at rest, charging and capacity test required.

In good order

- No fault codes in control units, malfunction indicator lamp off.
- Mileage of 177 752 km confirmed by 2017-2026 documents and control units.
- Hybrid battery: block spread 0.05 V; Toyota check on 17.09.2026 passed.
- Inverter replaced by Toyota dealer in 03.2026.
- Outer panels except the bonnet in original factory paint; glass and headlamps not replaced.
- IPO inspection passed, valid to 28.12.2026.
- No suspension knocks, even braking, no disc judder.

Need a lift inspection at a workshop? Contact us.

WhatsApp +351 926 445 084

info@grantauto.pt

About this report. This report reflects the condition of the vehicle at the date and time of inspection: on-site inspection, without a vehicle lift and without dismantling; the running gear is inspected with the wheels on full lock. The GRANT Check-Up template contains 497 checks covering all vehicle types; 433 apply to this vehicle. This report is not an IPO inspection, a warranty or a forecast of future faults. GRANT AUTO is independent of the seller and assesses condition only; the purchase decision rests with the client.

Previous owners' data on document photos has been masked. Photo numbers match the references in the report; each photo opens in full size.

GRANT AUTO mechanic signature

VERIFIED

GRANT AUTO AI review 18.09.2026

Photo report

Click a photo to open it in full size.

General view

4 photos



001 Front



004 Front, another angle




002 Rear




003 Rear, another angle

Documents


16 photos

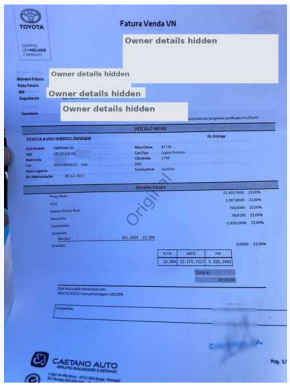


156 New vehicle sales invoice, 12.2017

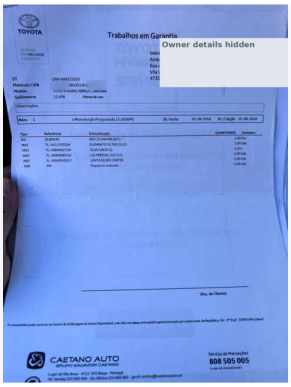


152 Warranty service, 08.2018, 11 498 km

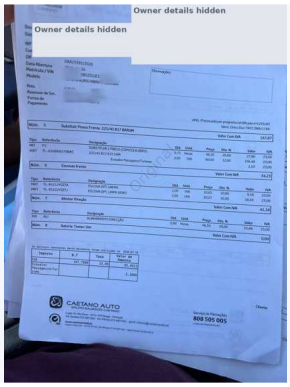


149 Dealer invoice, 07.2020, 32 972 km

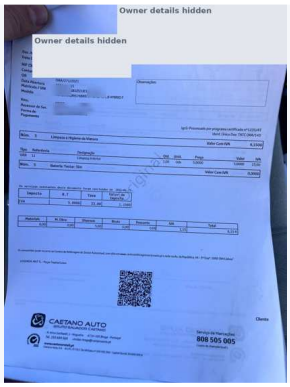


159 Dealer invoice, 01.2021, 48 630 km

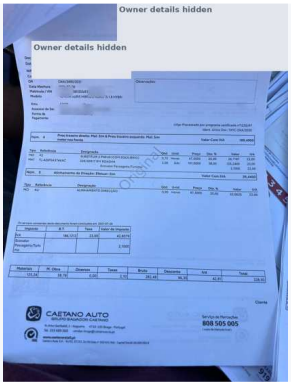


150 Dealer invoice, 07.2021, 62 170 km

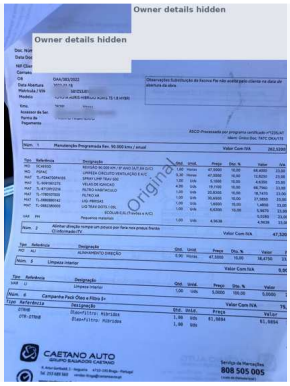


155 Dealer service, 01.2022, 76 291 km

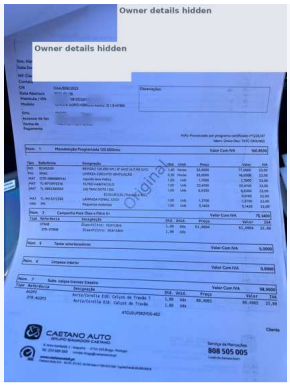


158 Dealer service, 02.2023, 106 355 km, rear pads

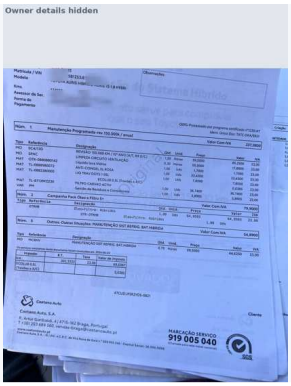


151 Dealer service, 06.2024, 134 135 km

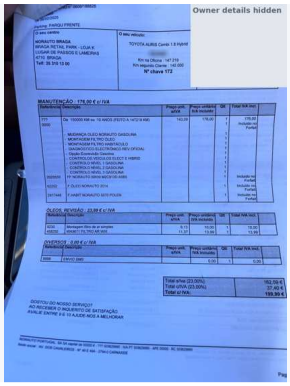


157 Norauto service, 02.2025, 147 219 km

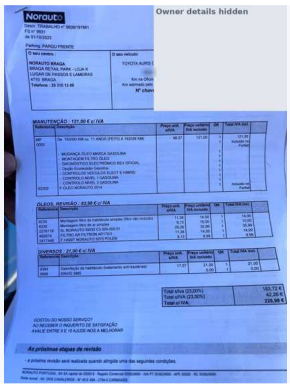


154 Norauto service, 10.2025, 162 036 km

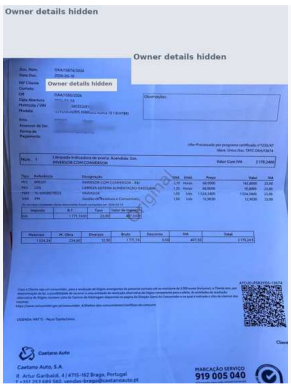


153 Inverter replaced at dealer, 03.2026, 169 263 km

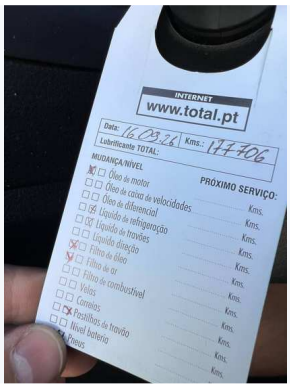

160 Oil change tag, 16.09.2026, 177 706 km

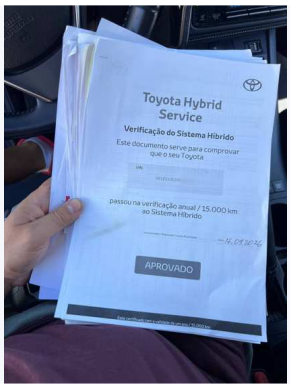

146 Toyota hybrid system check certificate

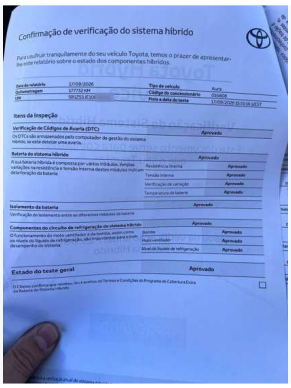

148 Toyota hybrid report 17.09.2026: passed



147 IPO inspection: passed, valid to 28.12.2026




019 Norauto sticker: next oil change

Paintwork: thickness gauge readings

43 photos



005 130 µm

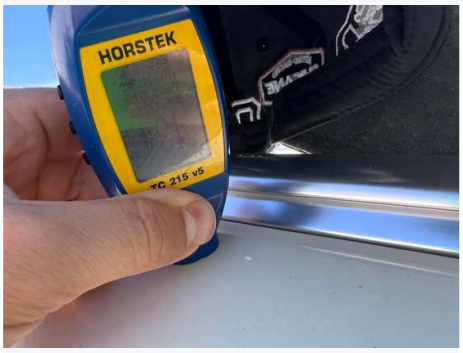

007 134 µm



008 130 µm, by rear lamp



009 121 µm



010 143 µm



014 130 µm



015 132 µm



016 114 µm



022 126 µm



023 127 µm



024 120-129 µm



025 124 µm, wing with Hybrid badge



026 121 µm



027 130 µm



028 Bonnet, 139 µm



029 Bonnet, 166 µm



030 Bonnet by grille, 120 µm



031 Roof, 125 µm



032 Roof, 137 µm



033 Roof, 120 µm



034 Roof, 132 µm



035 Roof, 130 µm



038 64 µm



040 132 µm



041 135 µm



043 89 µm



044 132 µm



045 118 µm



046 130 µm



047 133 µm



011 Aperture, 77 µm



012 Sill in aperture, 80 µm



013 Door aperture, 74 µm




017 Aperture, 74 µm



018 Pillar, 89 µm



020 Aperture, 53 µm

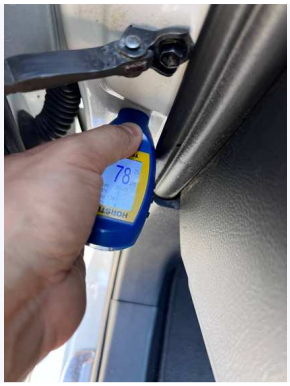

021 Aperture by check strap, 78 µm



036 Aperture, 84 µm



037 Sill, 57 µm



039 Sill, 80 µm



042 Aperture, 74 µm



049 Aperture, 77 µm



054 Strut tower under bonnet, 89 µm

Body: details and remarks

20 photos



061 Front bumper gap, left corner



062 Trim above left headlamp



063 Headlamp



064 Headlamp



055 Headlamp marking: Toyota, 29.11.2017



056 Second headlamp marking: Toyota



050 Bonnet hinge, bolts undisturbed



051 Bonnet hinge, bolts undisturbed



053 Inner wing under bonnet



065 Lower front bumper



066 Front undertray



067 Door edge: small chips




068 Lower door



070 Rear bumper lower trim: scuff




071 Wheel arch trim: scuffs

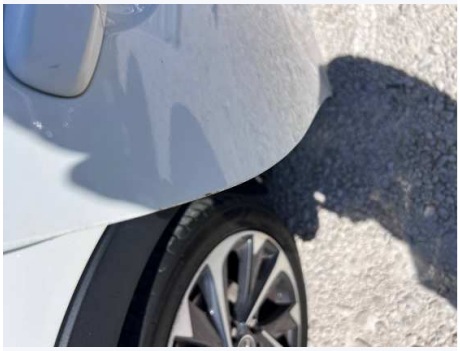

072 Rear wheel arch



076 Wheel arch trim

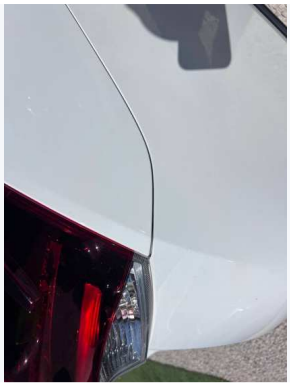

077 Rear lamp gap



074 Lower door



075 Door handle

Engine and hybrid system

7 photos



052 Engine bay



059 Oil filler cap



060 Dipstick



057 Expansion tank



058 Inverter coolant reservoir, high-voltage cables



133 Tailpipe




134 Soot: dry

Wheels, brakes, suspension

21 photos



078 Front disc

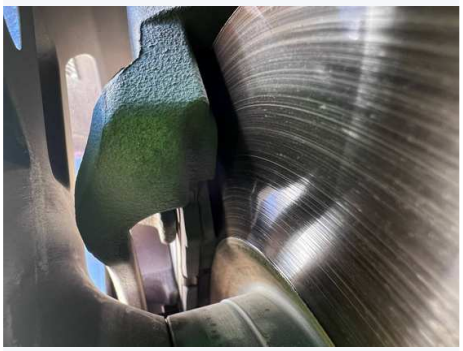

079 Front disc and caliper



086 Rear disc: worn, lip



087 Rear disc



080 Wheel, Firestone



082 Firestone, DOT 39/2024



090 Wheel, Firestone



083 Wheel, Three-A



084 Three-A, DOT 08/2023




088 Wheel, Three-A



089 Size 225/45 R17 94W



081 Tread

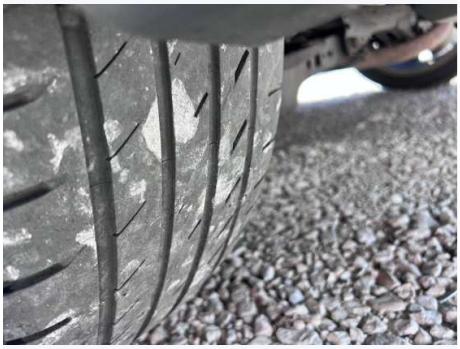

085 Tread




125 Front suspension, driveshaft boot




126 Front strut



127 Driveshaft

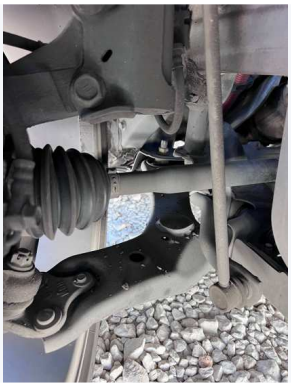

128 Suspension arm, driveshaft boot

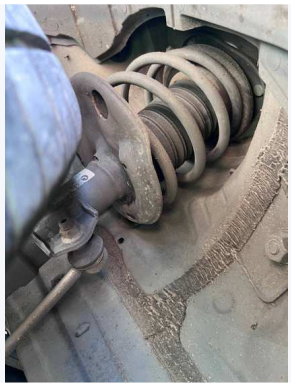

129 Front strut



130 Driveshaft



131 Rear suspension



132 Rear shock absorber and spring

Interior


35 photos



091 Driver's seat



092 Seat bolster

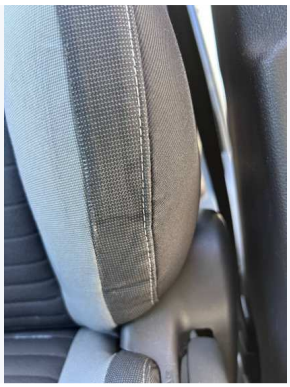

093 Backrest




124 Front seat



136 Seat fabric



096 Steering wheel and dashboard

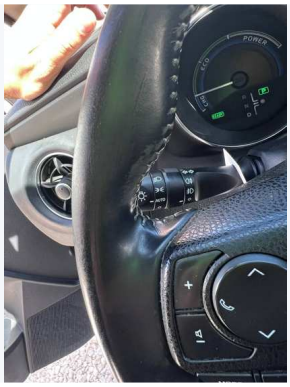

098 Steering wheel: leather wear



099 Steering wheel



094 Driver's door




095 Window switches



100 Centre console



101 Handbrake, cup holders

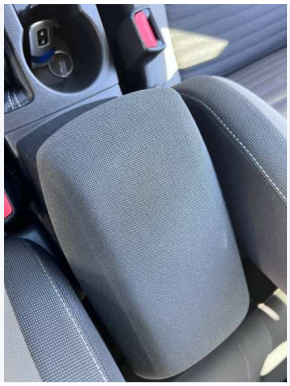

102 Armrest



103 Key




104 Second key



106 Dashboard



107 Headlining: soiling

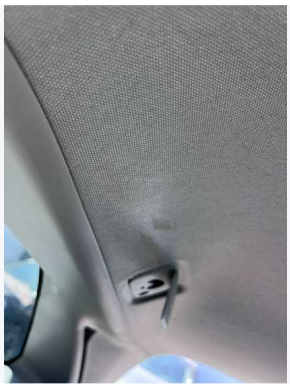

115 Headlining



116 Headlining



117 Headlining



118 Headlining



108 Rear seats



114 Rear seats




111 Front seat back



112 Rear console: soiling



109 Rear door

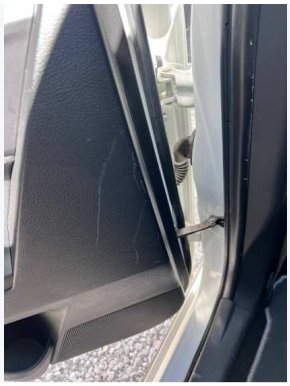

110 Rear door: scuffs



113 Rear door



119 Seal and pillar



120 Front door



121 Window switch



122 Pillar trim



123 Dashboard



069 Sill: soiling



073 Sill

Diagnostic scan


11 photos




135 Instrument cluster: READY, 177 752 km




137 OBD: systems without faults

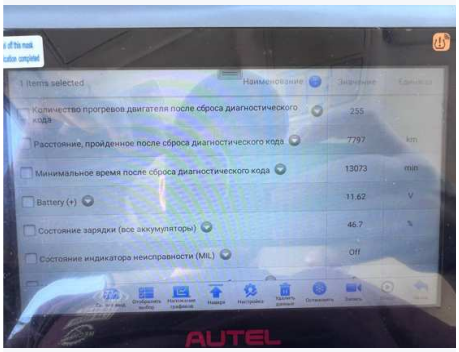

138 OBD: MIL off, 7 797 km since clearing, 12 V: 11.62 V

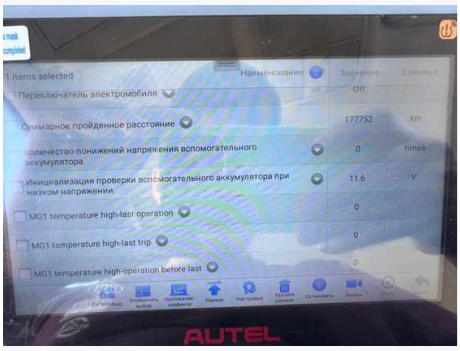

139 OBD: mileage 177 752 km

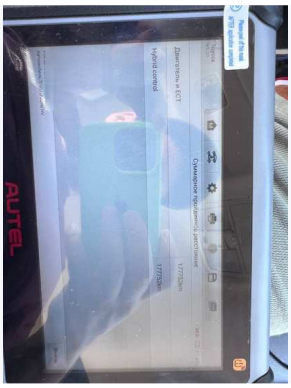


145 OBD: mileage in hybrid unit



140 Battery: voltage, blocks 1-7



141 Battery: voltage, blocks 8-14

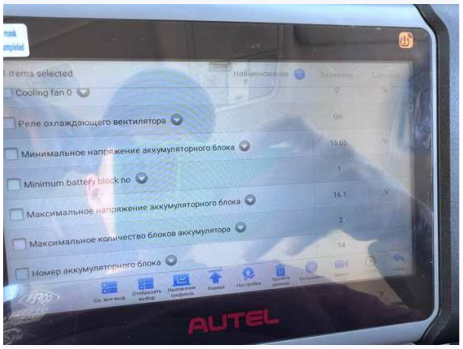

142 Battery: min. and max. voltage



143 Battery: resistance, blocks 1-7



144 Battery: resistance, blocks 8-14



105 Multimedia